


**6" UB's** – these support disused tram tracks and are effectively redundant.

Tops are not properly painted due to lack of access and salt water pools on the flange and runs down the beam causing staining.

**Multiple areas of Edge failure** due to lack of radius edges – another latent defect from 1999-2001.

Its calculated there are 100,000 linear metres of defective edges (with insufficient radius). These need to all be individually ground to a 3mm radius.

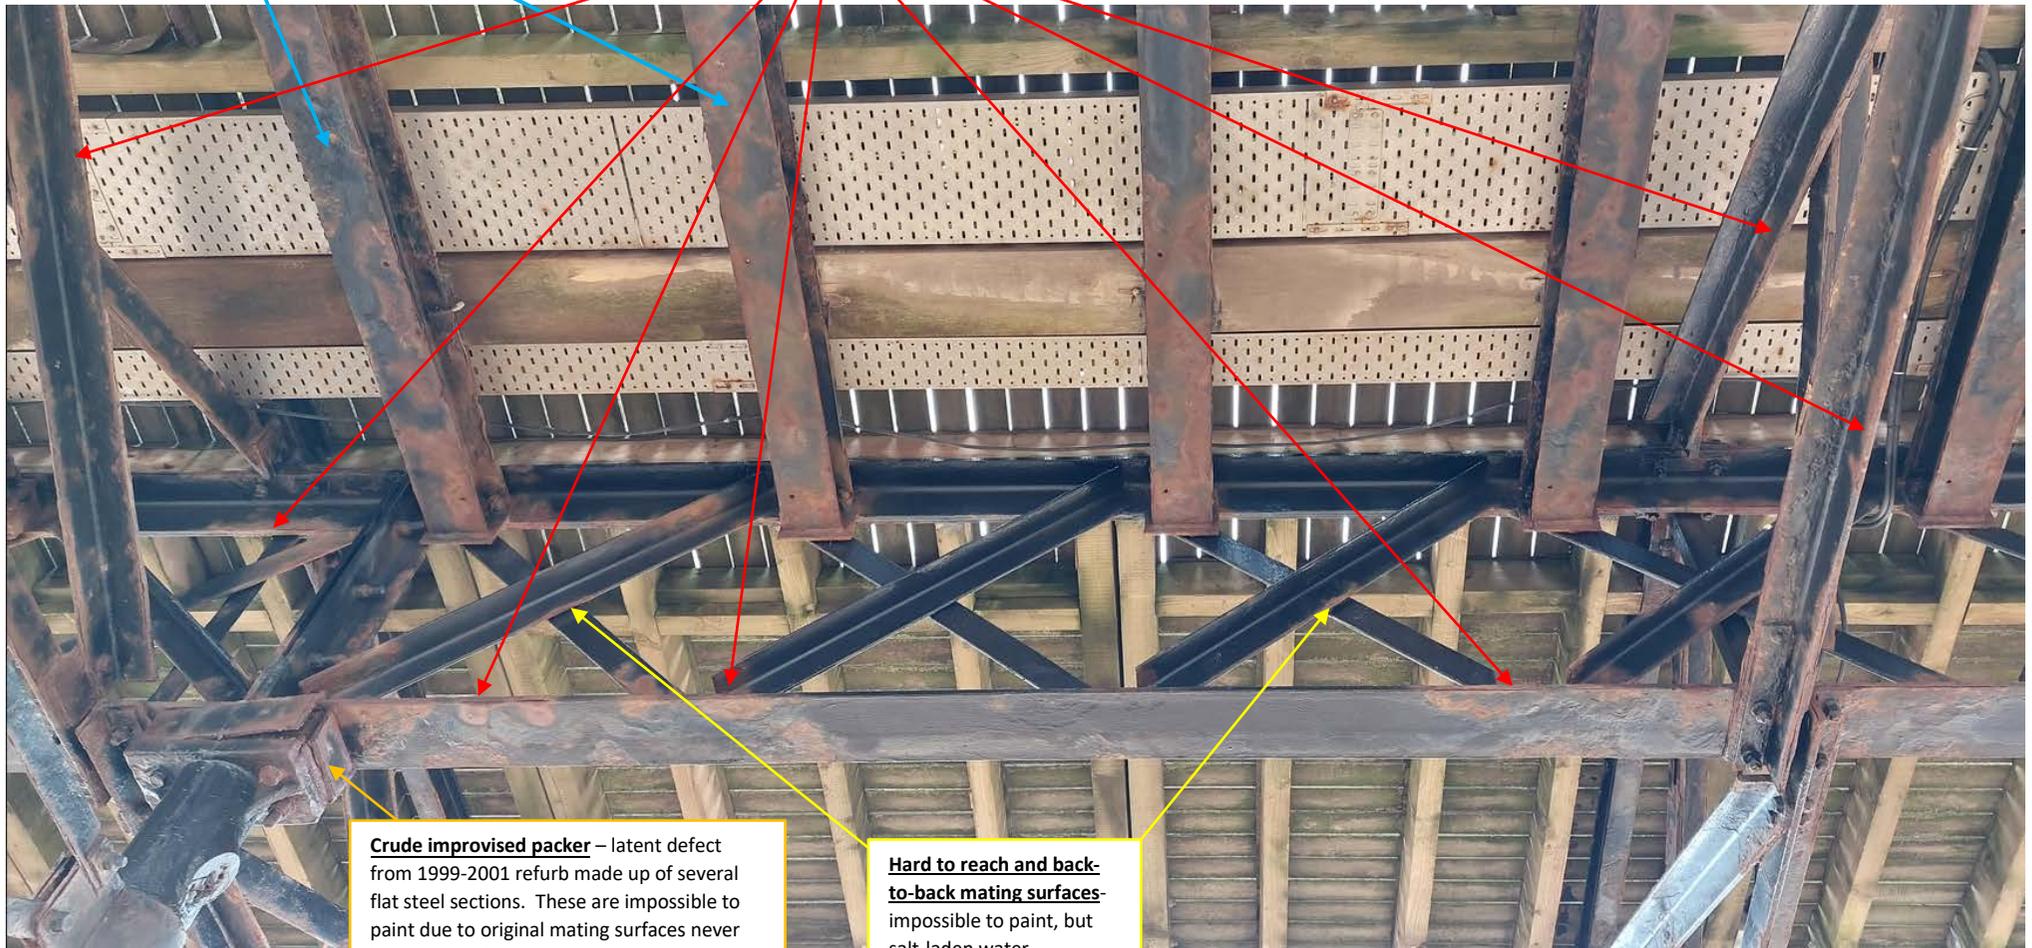

**Crude improvised packer** – latent defect from 1999-2001 refurb made up of several flat steel sections. These are impossible to paint due to original mating surfaces never being painted. These need to be removed and replaced with pre-formed stools.

**Hard to reach and back-to-back mating surfaces** – impossible to paint, but salt-laden water penetrates causing corrosion.